

OPERATION MANUAL

Edition

	<i>Month</i>	<i>year</i>
<i>1st</i>	<i>October</i>	<i>2003</i>
<i>2nd</i>	<i>June</i>	<i>2004</i>
<i>3rd</i>		
<i>4th</i>		
<i>5th</i>		

Table of Contents

Chapter1 Main Specification	2
Chapter2 Installation	3
Front and Back View of Indicator	3
Connecting Load Cell to Indicator	4
Serial Communication Interface(Optional)	4
Chapter3 Operation	5
Chapter4 Calibration	7
Chapter5 Errors Indication	9
Chapter6 Chargeable Battery	9
Chapter7 Maintenance	10

Chapter 1 Main Specification

1. Analog:

Input Signal: 0 ~ 10mV
Converting Speed: 40 times/second
A/D code: 360000
Non-linearity: 0.03%
Drift: 0.03%
Stimulating Voltage: DC+5V
Load Cell: $1 \times 350\Omega$

2. Display

Display: 0 ~ 999999
Interval: 1/2/5/10/20/50 (optional)

3. Serial Communication Interface (Optional)

Signal: RS232C
Transmission Distance: < 20m


4. Ambient Environment

Power Supply: AC 220v (~15% ~ +10%); 50HZ (-2% ~ +2%)
Ambient Temperature: 0°C ~40°C
Storing Temperature: -25°C ~55°C
Ambient Temperature: $\leq 85\%RH$
Warm-up Time: 10~15minutes
Fuse: 500mA


6. Weight: 2Kg (excluding battery)

Chapter 2 Installation

2.1 Front and back view of the indicator

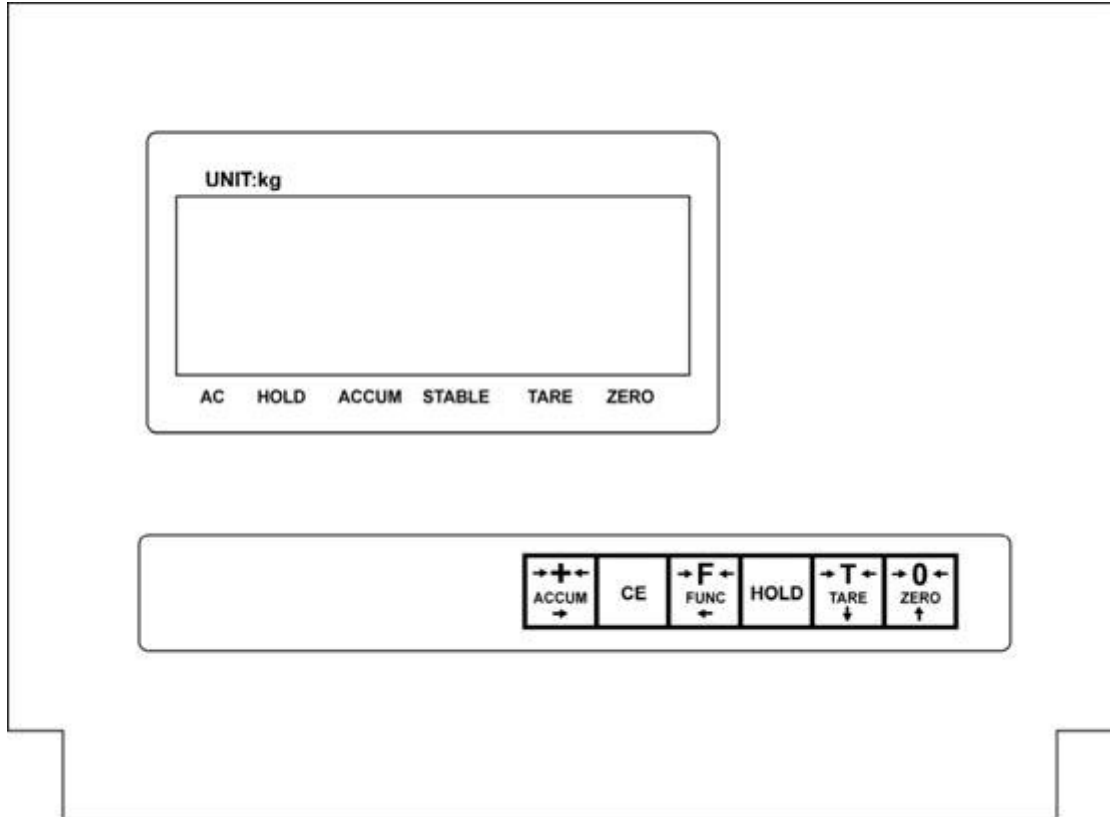


Front View of the Indicator

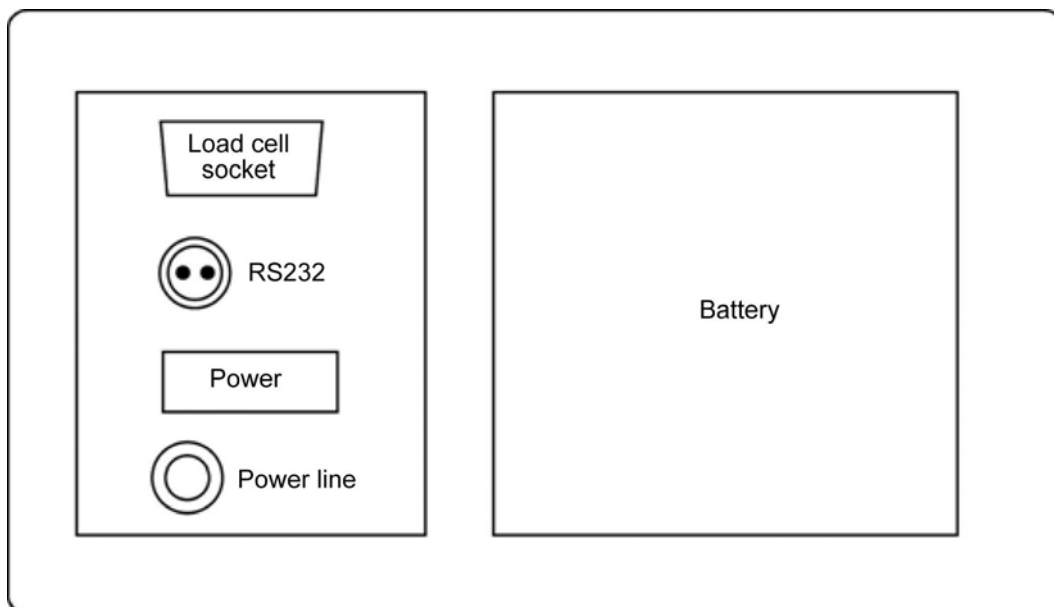

Back View of the Indicator

2.2 Connecting load cell to indicator

The 9 pin plug is for load cell , please connects the line as following graphs

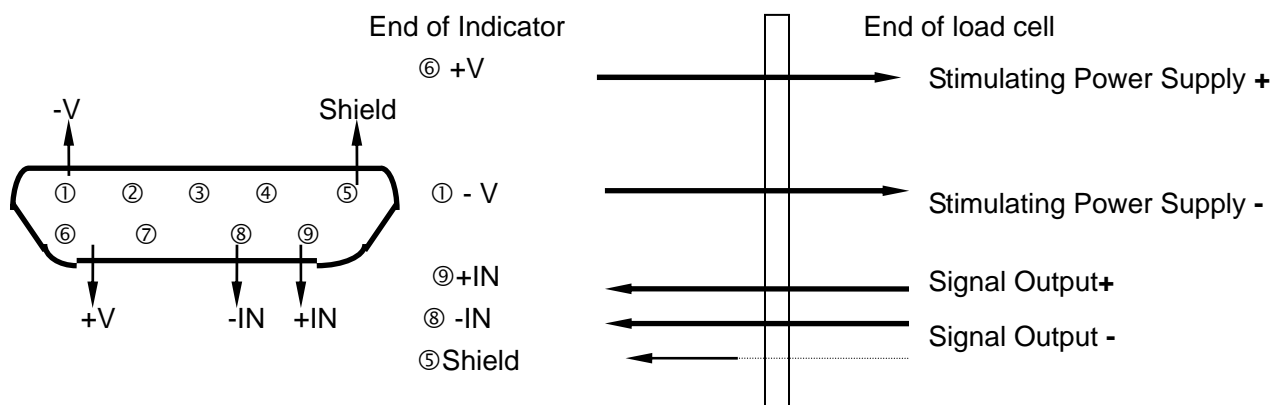

Connection of load cell

- ◆ You must cut off power when connecting load cell, the connection must be reliable.
- ◆ After connecting load cell, you should fasten plug with screw-driver.
- ◆ Load cell and indicator are static sensitive devices, you must adopt anti-static measures during operation. You must mount lightning rod in thunderstorm frequently happening area.

2.3 Serial Communication Interface (Optional)

1. Indicator communicate with computer by serial communication interface .
2. Connection

Indicator communication interface adopts 5 pin plug, pin definition is as follows

5 pin -----TXD signal (serial communication data)

1 pin ----- ground line

2 pin ----- shield line

The communication interface is 2pin plug.

1 pin -----signal (serial communication line)

2 pin -----ground line for communication

3. Parameter

① Signal: RS232C

② Baud Rate: 1200/2400/4800/9600 (Ref. Chapter 4 Calibration)

③ Data format:= 〈Weight data (including decimal)〉 ,ASCII Code

The low bit is prior to high bit and symbol. Negative symbol is"-"; Positive symbol is "0".

For example: While indicator displays -500.00Kg, serial output is 00.005-

While indicator displays 500.00Kg, serial output is 00.0050


Chapter 3 Operation

3.1 Turning on



3.1.1 Turn on the power, the indicator performs self-checking and displays current voltage of battery and go into weighing mode.

3.2 Operation



3.2.1

Press  for zero return, indicator returns to zero within the zero range 4%FS. To make sure the stabilization light is on when zero operation.



3.2.2

At weighing mode, press  to deduct displaying weight while it is positive and stabilization light is on. Indicator displays net weight "0", tare light is on, press  to deduct tare, tare light is off, indicator displays gross weigh.


3.2.3

At weighing mode, press  to enlarge the resolution of weight to 10 times. Press  again to get back.

3.2.4



At weighing mode, press  to lock the weight value. Holding light is on. The weight value will be hold even if you take object off or put it on. Press  again to get back

3.2.5 Manual accumulation

At weighing mode, while the weight value is large or equal to 20 counts and the value is stable, press  to perform manual accumulation operation. Meanwhile, indicator first shows the total accumulating times (two steps) :[n=] (that means the times displaying), after 1 second later, it displays accumulating times [****]; and then to display the total value of accumulation (two step):[totl =] (that means to display the total value of accumulation), after 1 second later, it displays accumulating value [*****], accumulating light is on.

Note: the max. accumulation times are 99999 (under the condition of accumulating amount \leq 999999); Prior to the delete operation, the accumulating amount is recorded even power off.

3.2.6 Automatic accumulation



At weighing mode, press  +  together, indicator performs automatic accumulation, and accumulating light flashes. At automatic accumulation mode, while the weight value is large or equal to 20 counts and the value keeps stable for 1-2 seconds, indicator performs one time automatic accumulation, displaying accumulation times and amount.

Note: The accumulating amount is not recorded under automatic accumulating mode when power off.

3.2.7

At weighing mode, press  to delete the accumulation times and amount.

3.2.8 Kg/lb diversion



 
 

At weighing mode, press  +  together, indicator performs unit diversion; while the unit is lb, the final decimal of the displaying value is lighted.

Note: once you operate accumulating and fail to delete the accumulation amount at one of the unit, unit diverting is not allowed ,unless you delete the accumulation amount

3.2.9 preset tare

At weighing mode, press  +  together, indicator performs tare presetting.


 






The procedure is as follows:

Step	Operation	display	Explanation
1		[*****]	Weighing display
2	Press  + 	[P00000]	Remind to input preset tare
3	Input preset tare, eg “6000”	[6000]	Press  6 times to change the lowest digit to “6”, and then press  3 times to set the value as “6000”, and press  to confirm
4		[*****]	Turn back to weighing mode, displaying the net weight of deducting tare

3.2.10 Automatic dormancy

Indicator keeps at stable mode for 2 minutes and no any operating and weighing, it will turn to automatic dormancy, meanwhile the final decimal is lighted. Any operating and weighing will arouse it to working mode.

3.3 At calibration and preset tare mode, some of the keys perform as follows



 





1.  : perform “1” adding, press  to add “1” on the lowest digit .
2.  : perform moving, press  to move the lowest digit to left.
3.  : perform inputting, press  to input setting value to the indicator
4.  : perform exiting, press  to exit calibration









Chapter 4 Calibration

4.1 Turn on the indicator and connect load cell correctly . the indicator warms up for 15-30 minutes at “no load”

At weighing mode, press  +  together for calibration

4.2 Calibration steps

Step	Operation	Display	Explanation
1		[*****]	Weighing display
2	Press  + 	[d *]	Setting of interval: indicator displays the original interval, which can be updated by operator
3	Input updated interval Eg: “1” Press  once to change the value to “1” Press  for confirmation	[d 1]	Parameter range:1,2,5,10,20,50, Press  to confirm the updated one is as same as the original one
4		[dP *]	Decimal setting: Indicator displays the original decimal position, which can be updated by operator.
5	Input updated decimal Eg: “3” Press  three times to change the value to “3” Press  for confirmation	[dP 3]	Parameter range:0~5, 0 means no decimal, 1~5 separately means the decimal position from 1~5 Press  to confirm the updated one is as same as the original one.

6		[F *****]	F.S setting: indicator displays the original F.S., which can be updated by operator.
7	<p>Input undated F.S. Eg: "6000"</p> <p>Press  six times to change the value to "6", and then press  three times to move to "6000", press  for confirmation</p>	[6000]	If there is no need for zero and F.S calibration, press  to step 13, otherwise you must input F.S value to step 8 and 9.
8		[nloAd]	Zero calibration: indicator self-checks the zero position, provided indicator didn't calibrated zero before, it displays the zero inner code, otherwise it go to step 9
9		[LoAd]	F.S calibration: Zero position is confirmed, you can load weights for the preparation of F.S calibration, that should be $>1/2$ of the F.S
10	Finish of weight loading, press 	[*****]	Indicator displays the inner code of the loaded weight
11		[*****]	At the stabilization of the value, indicator will display the weight of loaded weight
12	<p>Input the actual weight of loaded weight Eg: "3000"</p> <p>Press  three times to change the value to "3", and then press  for confirmation</p>	[3000]	Press  to step 13, if the inputted weight is as same as the loaded weight.
13		[bt *]	Baud rate: Indicator displays the original baud rate parameter, which can be updated by operator
14		[*****]	Calibration is over, exit to weighing mode

Chapter 5 Error Indication

ERROR0	The zero inner code is over 260000 when calibration.
ERROR1	The loaded inner code is less ; load cell capacity is more .
ERROR2	The loaded inner code is more ; load cell capacity is less.
ERROR 3	Calibration exceeding
HHHHHH	The zero lever is too high or load on the platform .
LLLLLLL	The zero lever is to high or no pan on the platform.

Chapter 6 Chargeable Battery

6.1 Turing on the AC power, the indicator will charge the battery automatically. So if you don't use battery frequently, you should take battery out.

Note: red end is +, black end is -. Wrong connection will destroy indicator.

Note: The built-in battery should be fully charged before it is used for the first time.

6.2 Only when you turn off the AC power, and push start key, battery works.

Displaying [LuoL] means the insufficient of voltage, it needs charge.

6.3 When you use the battery first time, you should charge the battery for 20 hours in order to prevent low voltage resulted from the self leakage of the battery.

6.4 If you don't use battery for a long time, you should charge the battery for 10-12 hours for each 2 month to prolong using life of battery.

6.5 The battery is easily exhausted products. And it is not granted free guarantee.

Chapter 7 Maintenance

- 7.1 To guarantee indicator clarity and using life, the indicator shouldn't be placed directly under sunshine and should be set in the plain space.
- 7.2 The indicator can't be placed into the place where the dust pollution and vibration are serious.
- 7.3 Load cell should connect with indicator reliably, and the system should be well connected into ground. The indicator must be protected from high electrical field and high magnetic field.
- ◆ In order to protect the operator, indicator and relevant device, you should mount lightning rod in thunderstorm frequently happening area.
 - ◆ Load cell and indicator are static sensitive device, you must adopt anti static measures.
- 7.4 It is strictly forbidden to clean the case of indicator with intensive solvents (for example: benzene and nitro oils)
- 7.5 Liquid and conducting particle should not be poured into the indicator, otherwise the electronic components will be damaged and electric shock is likely to happen.
- 7.6 You should cut off power supply of indicator and relevant device before you pull-in and out the connecting line of indicator and external device.
- ◆ You must cut off power supply of indicator, before pulling out connecting line of load cell.
- 7.7 During operation, if trouble occurs, operator must pull off the power supply plug immediately, and user should return this indicator to our company for repair. Non-weighing manufacturer should not repair it, or by yourself, otherwise further destruction may happen.
- 7.8 The storage is not granted the free repair guarantee, because it is easily exhausted products.
- ◆ In order to prolong using life, please charge the cell fully before using it. If you don't use the indicator for a long time, you must charge the cell every two month and for eight hours/each charging time.
 - ◆ Moving or installation must be carefully taken and must avoid strong vibration, impact and bump in order to protect the storage cell from being damaged.
- 7.9 From invoice date, the indicator has a one-year free repair period. If any non-artificially obstacle about the indicator happens under correct using conditions within this period, the user is allowed to send the product with its guarantee card (of the correct number) back to our corporation for free repair. The indicator shouldn't be taken apart, otherwise free guarantee will be cancelled.